

# CARDONE ProTech

Supporting Today's Professional Technician



## Improper Placement of Fitting O-ring Results in No Pressure

### Application:

All vehicles equipped with power steering.

### Problem:


No pressure output from power steering pump after installation of a new O-ring on the power steering pressure fitting.

### Cause:

Incorrect placement of O-ring on the pressure fitting, blocking the flow of fluid from the bypass hole to the flow control valve. This causes a no-pressure condition.

### Solution:

Install the replacement O-ring in the correct position on the fitting. Also make sure piston is moving freely in bore, a stuck piston will cause the same problem.

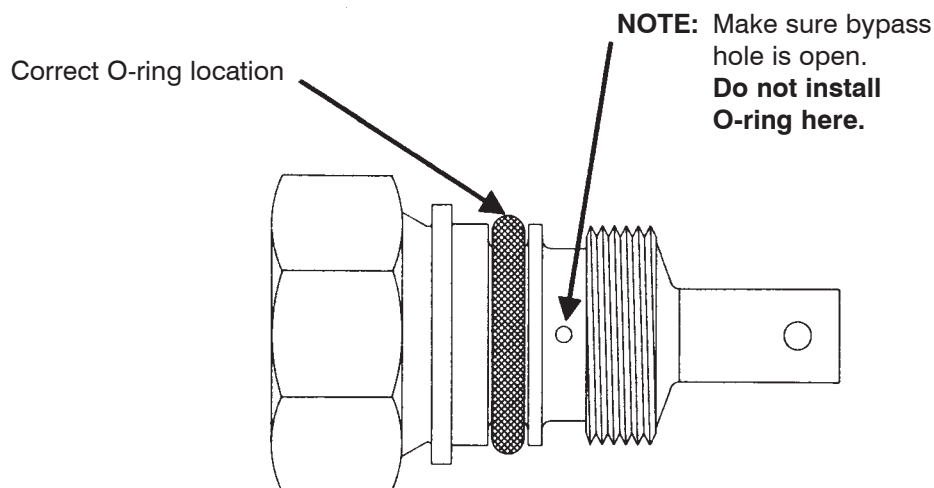

### Note:

See instruction sheet 93-0347-20.

For other ProTech publications, visit [www.cardone.com](http://www.cardone.com)  
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799