

CARDONE ProTech

Supporting Today's Professional Technician



Hydro-Boost Flush Procedure

Application:

Vehicles with power steering pump powered hydroboost brake systems.

Problem:

Pedal kickback, grabbing brakes, increased pedal effort, hissing noise while applying brakes or increased steering effort.

Cause:

Possible contamination of hydroboost system due to deteriorating hoses, contaminated fluid or steering unit failure.

Solution:

It may be possible to restore proper operation by flushing the system using the following procedure. An in-line filter (CARDONE part 20-FLT1 or 20-FLT2) MUST be used during the cleaning cycle. (see Note below) After cleaning if the filter and fluid show obvious signs of hose contamination all hoses must be replaced, and both fluid and the in-line filter changed again.

Service Procedure:

1. Chock and hold vehicle with hand brake.
2. Check power steering pump fluid level, fill as necessary, do not over fill.
3. Start engine, let idle and allow to reach operating temperature.
4. Raise idle to 2200 rpm and maintain throughout test.
5. Pump brake pedal firmly 25 times.
6. Turn steering wheel lock-to-lock 5 times.
7. Hold at 2200 rpm for 15 seconds then allow engine to return to idle.
8. At idle, turn steering wheel lock-to-lock 3 times without applying brakes. If hard effort or binding is noticed repeat steps 3 thru 6 once. If proper operation is not restored go to step 10. Complete steps 10 thru 12, perform necessary repairs, and repeat from step 1.
9. Test brakes for proper operation before moving vehicle, then drive vehicle 5 to 10 mph. Apply brakes to full stop verifying booster operation and steering action.
10. If brakes do not grab and steering effort is normal, shut off engine, allow system to cool then inspect in-line filter. If hose debris or contamination is found, hoses and fluid should be replaced and test repeated.
11. If grabbing is felt, pedal is hard or pedal stays down, check power steering pump before replacing the booster.
12. If steering effort is effected, power steering pump and steering unit tests must be performed (see Pro Techs PT 20-0003, 20-0004, 20-0005, 20-0008, 20-0012, 20-0016, 20-0018, 52-0001).

Note:

When installing the filter refer to instructions on the back of the package for proper installation.

For other ProTech publications, visit www.cardone.com
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799