

# CARDONE ProTech

Supporting Today's Professional Technician



## VIN Entry Problem on R Series Dodge Truck

### Application:

Dodge R Series Trucks Built Prior to July 15, 2003 with Dual Rear Wheels.

### Problem:

Replacing and programming the PCM causes an ABS (antilock brakes) error code.

### Cause:

Some dual rear wheel trucks have a VIN number "3" as sixth character and should have the number "4."

### Solution:

When replacing the PCM, the complete VIN number must be inputted during the programming procedure. **Dual rear wheel vehicles must have a number "4" inputted as the sixth digit, even if the actual VIN has a number "3."** Input a number "4" in place of the "3." If the "3" is inputted, a conflict is likely to occur with the ABS module which will set an error code. This condition does not affect the Flash Reprogramming procedure. Refer to TSB 18-024-02.

6<sup>TH</sup> DIGIT MUST BE A "4"

3 D 7 M U (3) 8 C 2 3 G 1 2 3 4 5 6

Typical VIN

For other ProTech publications, visit [www.cardone.com](http://www.cardone.com)  
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799