

CARDONE ProTech

Supporting Today's Professional Technician



Protecting GM Wiper Motors from Water Intrusion

Application:

All wiper motors

Problem:


Wiper motors with and without integrated electronic pulse board not working properly or at all.

Cause:

Wiper motor and/or electronic components may have failed due to water intrusion.

Solution:

To protect the replacement wiper motor and pulse board, be sure water does not drain on wiper motor assembly. Remove any debris that might block or restrict the flow of drain water to the left or right fender well areas. Be sure to also check for proper operation of control switch and associated wiring.

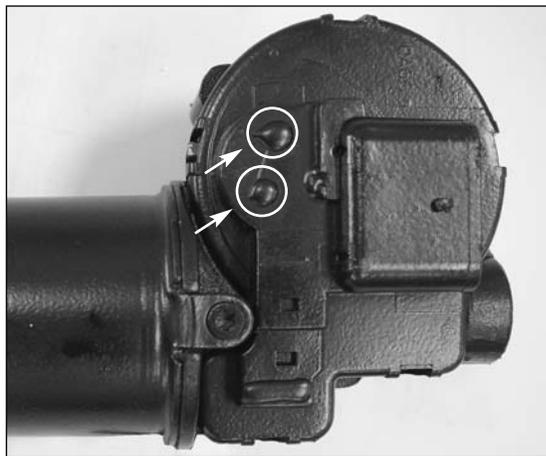

CARDONE Upgrade:

To prevent water intrusion, our replacement units are re-engineered to overcome original design flaws. Vent holes that allow water entry are blocked, therefore protecting the motor & its electronic components.

For other ProTech publications, visit www.cardone.com
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799