

CARDONE ProTech

Supporting Today's Professional Technician




Power Steering Binding or Lack of Assist After Installation

Application: All vehicles with Power Steering.

Problem: Binding, poor return ability, leaking, stiff steering, noise or fluid overheating.

Cause: Restricted flow of hydraulic fluid. Kinked or damaged line or accumulation of grit and debris, block proper flow of fluid through Power Steering System.

Solution: Check hose routing and condition. Make sure all lines are O.E. Specification. Before installing any replacement unit, flush the entire system and replace **ALL** hoses.

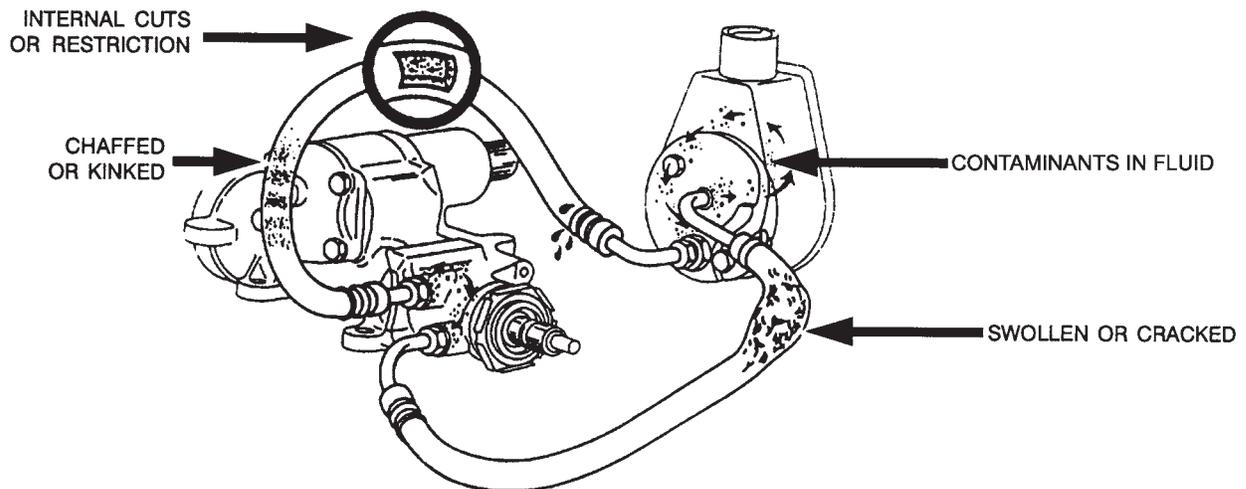

Note: CONTAMINATED FLUID COULD CAUSE THE SAME SYMPTOMS. ALWAYS FLUSH THE ENTIRE SYSTEM AND INSTALL A POWER STEERING FILTER.

For other ProTech publications, visit www.cardone.com
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799