

CARDONE ProTech

Supporting Today's Professional Technician



GM or Subaru CVs Appear Boxed Wrong — Transfer Stub Shaft

Application:

GM vehicles using 60-1216, 1243 or 1323.
Subaru vehicles using 60-7007, 7209.

Problem:

Inboard housing of original unit is male; the replacement unit is female. Is the replacement unit boxed wrong?

Cause:


The inboard stub shaft is removable. For axles of this type, the original stub shaft is either stuck in the original unit or is secured with a roll pin.

Solution:

Transfer the stub shaft to the replacement unit. Some typical units are shown below. CARDONE supplies a new roll pin for units of that design.



Subaru Design

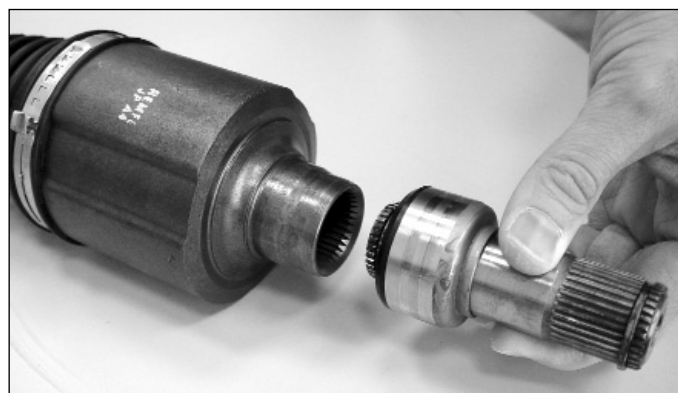

GM Design

For other ProTech publications, visit www.cardone.com
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799