

# CARDONE ProTech

Supporting Today's Professional Technician



## Overlooked Pressure Hose Seal Causes Power Steering Leaks

### Application:

All Power Steering systems using O-ring seals on fittings.

### Problem:


After replacing the Power Steering Pump or steering unit, leaks develop at fittings.

### Cause:

Original O-rings were not replaced, damaged or not properly installed.

### Solution:

Install all supplied O-ring seals as per installation instructions. Be sure to replace the seal inside the pressure hose.

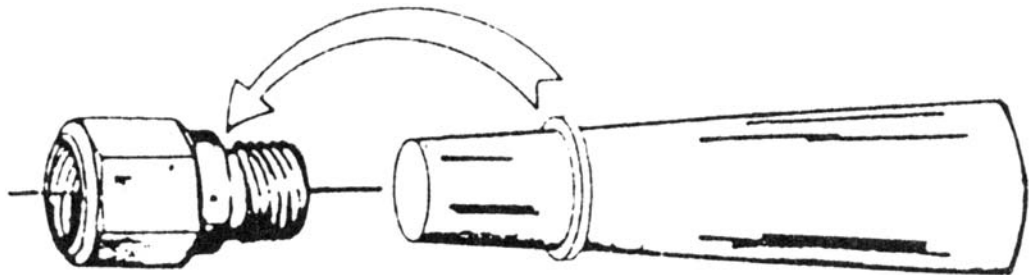

### Installation Tip:

Slide pressure hose fitting back and remove old seal. Soften new seal in warm water, expand over a tapered punch, then transfer to hose as shown.

For other ProTech publications, visit [www.cardone.com](http://www.cardone.com)  
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799