

CARDONE ProTech

Supporting Today's Professional Technician




DON'T GET YOUR LINES CROSSED

Application: All linkage-type Power Steering Systems

Problem: After replacing the power steering unit, the vehicle steers violently from side to side by itself.

Solution: When installing a control valve or power cylinder, be extremely careful not to cross the pressure lines to the cylinder. Failure to do so can lead to a malfunction and could result in bodily injury and VOID WARRANTY.

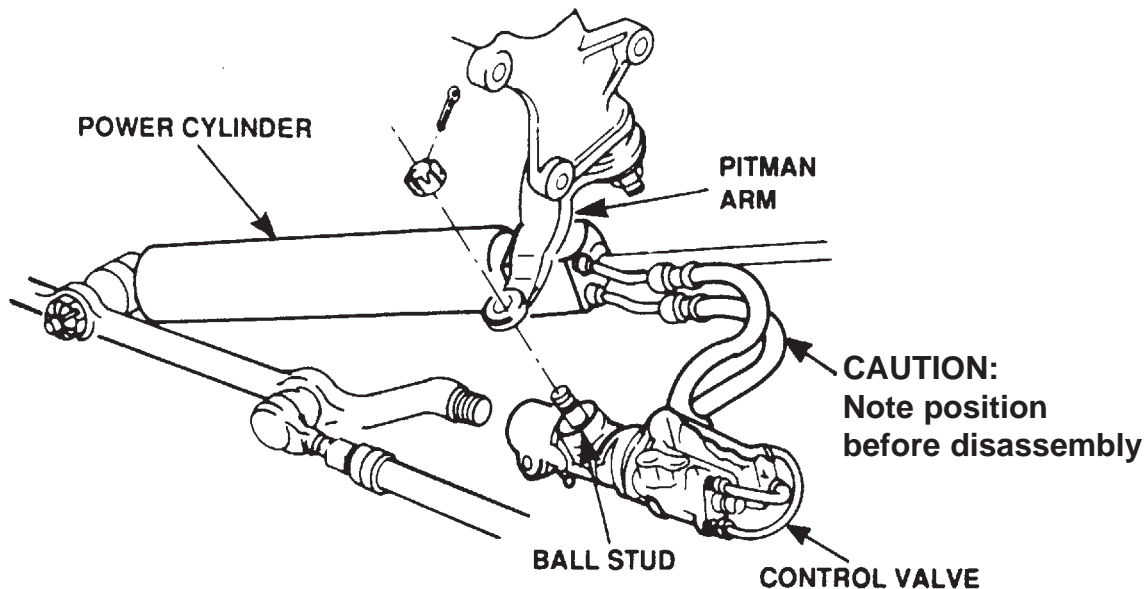

Caution: When replacing any part in the power steering system, ALWAYS FLUSH THE SYSTEM USING APPROVED POWER STEERING FLUID AND REPLACE HOSES! New parts can become contaminated with residues from existing components possibly causing malfunctions.

For other ProTech publications, visit www.cardone.com
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799